

[Federal Register Volume 86, Number 103 (Tuesday, June 1, 2021)]

[Rules and Regulations]

[Pages 29185-29187]

From the Federal Register Online via the Government Publishing Office [www.gpo.gov]

[FR Doc No: 2021-11426]

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2021-0097; Project Identifier MCAI-2020-01334-T; Amendment 39-21559; AD 2021-10-26]

RIN 2120-AA64

Airworthiness Directives; Bombardier, Inc., Airplanes

AGENCY: Federal Aviation Administration (FAA), Department of Transportation (DOT).

ACTION: Final rule.

SUMMARY: The FAA is adopting a new airworthiness directive (AD) for certain Bombardier, Inc., Model BD-100-1A10 airplanes. This AD was prompted by reports of DC motor pump (DCMP) failures during production flight tests. This AD requires installing a redesigned DCMP electric motor assembly. The FAA is issuing this AD to address the unsafe condition on these products.

DATES: This AD is effective July 6, 2021.

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of July 6, 2021.

ADDRESSES: For service information identified in this final rule, contact Bombardier, Inc., 200 Côte-Vertu Road West, Dorval, Québec H4S 2A3, Canada; North America toll-free telephone 1-866-538-1247 or direct-dial telephone 1-514-855-2999; email ac.yul@aero.bombardier.com; internet <https://www.bombardier.com>. You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195. It is also available on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0097.

Examining the AD Docket

You may examine the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0097; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this final rule, any comments received, and other information. The address for Docket Operations is U.S. Department of

Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

FOR FURTHER INFORMATION CONTACT: Steven Dzierzynski, Aerospace Engineer, Avionics and Electrical Systems Services Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; phone: 516-228-7367; fax: 516-794-5531; email: 9-avs-nyaco-cos@faa.gov.

SUPPLEMENTARY INFORMATION:

Background

Transport Canada Civil Aviation (TCCA), which is the aviation authority for Canada, has issued TCCA AD CF-2020-31, dated September 23, 2020 (TCCA AD CF-2020-31) (also referred to as the Mandatory Continuing Airworthiness Information, or the MCAI), to correct an unsafe condition for certain Bombardier, Inc., Model BD-100-1A10 airplanes. You may examine the MCAI in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0097.

The FAA issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to certain Bombardier, Inc., Model BD-100-1A10 airplanes. The NPRM published in the Federal Register on February 24, 2021 (86 FR 11163). The NPRM was prompted by reports of DCMP failures during production flight tests. The NPRM proposed to require installing a redesigned DCMP electric motor assembly. The FAA is issuing this AD to address failures of the DCMP and electrical system generators, which could lead to the loss of normal electrical power on the airplane. See the MCAI for additional background information.

Comments

The FAA gave the public the opportunity to participate in developing this final rule. The FAA received no comments on the NPRM or on the determination of the cost to the public.

Conclusion

The FAA reviewed the relevant data and determined that air safety and the public interest require adopting this final rule as proposed, except for minor editorial changes. The FAA has determined that these minor changes:

- Are consistent with the intent that was proposed in the NPRM for addressing the unsafe condition; and
- Do not add any additional burden upon the public than was already proposed in the NPRM.

Related Service Information Under 1 CFR Part 51

Bombardier has issued Service Bulletin 100-29-18, Revision 03, dated December 18, 2014. This service information describes procedures for installing the redesigned DCMP electric motor assembly, having part number (P/N) 945202-3 (including a wiring modification and a structural modification). This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

Costs of Compliance

The FAA estimates that this AD affects 239 airplanes of U.S. registry. The FAA estimates the following costs to comply with this AD:

Estimated Costs for Required Actions

Labor cost	Parts cost	Cost per product	Cost on U.S. operators
68 work-hours × \$85 per hour = \$5,780	\$18,964	\$24,744	\$5,913,816

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Will not affect intrastate aviation in Alaska, and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. The FAA amends § 39.13 by adding the following new airworthiness directive:



2021-10-26 Bombardier, Inc.: Amendment 39-21559; Docket No. FAA-2021-0097; Project Identifier MCAI-2020-01334-T.

(a) Effective Date

This airworthiness directive (AD) is effective July 6, 2021.

(b) Affected ADs

None.

(c) Applicability

This AD applies to Bombardier, Inc., Model BD-100-1A10 airplanes, certificated in any category, serial numbers 20003 through 20406 inclusive.

(d) Subject

Air Transport Association (ATA) of America Code 29, Hydraulic power.

(e) Reason

This AD was prompted by reports of DC motor pump (DCMP) failures during production flight tests. These failures caused the electrical system generators to disconnect due to excessive induced voltage in the bus, caused by the DCMP overheating at high altitudes. The FAA is issuing this AD to address failures of the DCMP and electrical system generators, which could lead to the loss of normal electrical power on the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Required Actions

Within 6 months after the effective date of this AD: Install the redesigned DCMP electric motor assembly, having part number (P/N) 945202-3, in accordance with the Accomplishment Instructions of Bombardier Service Bulletin 100-29-18, Revision 03, dated December 18, 2014.

(h) Parts Installation Prohibition

After accomplishing the installation required by paragraph (g) of this AD, no person may install a DCMP having P/N MB74F-9/-7 on any airplane.

(i) Credit for Previous Actions

This paragraph provides credit for actions required by paragraph (g) of this AD, if those actions were performed before the effective date of this AD using Bombardier Service Bulletin 100-29-18, dated July 2, 2013; Bombardier Service Bulletin 100-29-18, Revision 01, dated January 21, 2014; or Bombardier Service Bulletin 100-29-18, Revision 02, dated July 18, 2014.

(j) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) Alternative Methods of Compliance (AMOCs): The Manager, New York ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the certification office, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; fax 516-794-5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) Contacting the Manufacturer: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, New York ACO Branch, FAA; or Transport Canada Civil Aviation (TCCA); or Bombardier, Inc.'s TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

(k) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) TCCA AD CF-2020-31, dated September 23, 2020, for related information. This MCAI may be found in the AD docket on the internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0097.

(2) For more information about this AD, contact Steven Dzierzynski, Aerospace Engineer, Avionics and Electrical Systems Services Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; phone: 516-228-7367; fax: 516-794-5531; email: 9-avs-nyaco-cos@faa.gov.

(3) Service information identified in this AD that is not incorporated by reference is available at the addresses specified in paragraphs (l)(3) and (4) of this AD.

(l) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) Bombardier Service Bulletin 100-29-18, Revision 03, dated December 18, 2014.

(ii) [Reserved]

(3) For service information identified in this AD, contact Bombardier, Inc., 200 Côte-Vertu Road West, Dorval, Québec H4S 2A3, Canada; North America toll-free telephone 1-866-538-1247 or direct-dial telephone 1-514-855-2999; email ac.yul@aero.bombardier.com; internet <https://www.bombardier.com>.

(4) You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, email fedreg.legal@nara.gov, or go to: <https://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued on May 7, 2021.

Gaetano A. Sciortino,
Deputy Director for Strategic Initiatives, Compliance & Airworthiness Division, Aircraft
Certification Service.

[FR Doc. 2021-11426 Filed 5-28-21; 8:45 am]